PX-20S ISA/PCI Bridge Backplane User's Manual



@Copyright 2000

All Rights Reserved.

Manual first edition January 2000

The information in this document is subject to change without prior notice in order to improve reliability, design and function and does not represent a commitment on the part of the manufacture.

Contents

Introduction	2
Product Features	2
Routing List	3
Board Drawing	3
Connectors	4
Pin Assignment	4
Installation Guide	5

Introduction

PX-20S is exactly the backplane what you want, even in the future. As you know, most of the adapters are of PCI bus, and ISA adapters are on the decrease in the market. If this problem have bothered you for a long time, then PX-20S is the right answer for you. In order to solve the problem, PX-20S, includes 12 32-bit PCI slots (5V/3.3V) on board, gives the great flexibility for your system's extension. We have added P10 (+5V) and DC power outlet (including +3.3V, +5V, -5V, +12V, and -12V) on PX-20S to keep system more stable. You can acquire a power supply with great stability, even as the system work under heavy load. Besides, we also add a connector for ATX power supply to which you can connect your SBC (SBC must have the ability to use ATX power).

Product Features

Standard

- ♦ PCI-conforms to PICMG 2.1 specification.
- ♦ ISA-conforms to IEEE P996 specification.

PCB

- ♦ The Printed Circuit Boards (PCB) overall dimension is 264.2mm x 415.9mm (10.4"x 16.4") and total thickness is 1.6mm (4 layers).
- Mounting holes are provided and are located to conform to the baby AT form factor. Mounting holes are connected to Signal ground internally.
- ◆ Operating Temperature; 0 to 60°C (32 to 140°F).
- ♦ Storage Temperature; -20 to 85°C (-4 to 185°F).
- ♦ Humidity; 5% to 95%, non-condensing.
- ♦ EMI/Safety; Meets FCC, CE Class A and UL, CSA and TUV.

Connector


- ◆ Dual slots PCI/ISA for the CPU board.
- ♦ Six ISA slots for full-size ISA board.
- ◆ Twelve 32-bit PCI slots for full-sized boards on the Primary bus, All slots are Master/Slave configurable by using Bus Mastering Scheme.
- ♦ One AT standard power connector, 12 pins, 5A max, per pin for +5V, -5V, +12V, and -12V voltages and Ground.
- ♦ One ATX standard power connector; 20 pins, 5A max, per pin for +3.3V, +5V, +5VSB, -5V, +12V, and -12V voltages, Ground, and power Good signal.

- One ATX control connector to distribute signals coming from the CPU boards onto connector for soft on/off ATX power supply.
- ♦ One P10 standard power connector, 5A max, per pin for +5V and Ground.
- ♦ Two DC power outlet.
- Pairs of header for local connection of a fan power, and power LEDs.

Routing List

PCI SLOT	1	4	2-1	2-2	2-3	2-4	2-5	3-1	3-2	3-3	3-4	3-5
IDSEL	AD31	AD28	2_AD23	2_AD23	2_AD21	2_AD20	2_AD24	3_AD23	3_AD22	3_AD21	3_AD20	3_AD24
INTA	В	A	С	В	A	D	D	В	A	D	С	С
INTB	С	В	D	С	В	A	A	С	В	A	D	D
INTC	D	С	A	D	С	В	В	D	С	В	A	A
INTD	A	D	В	A	D	С	С	A	D	С	В	В

Board Drawing

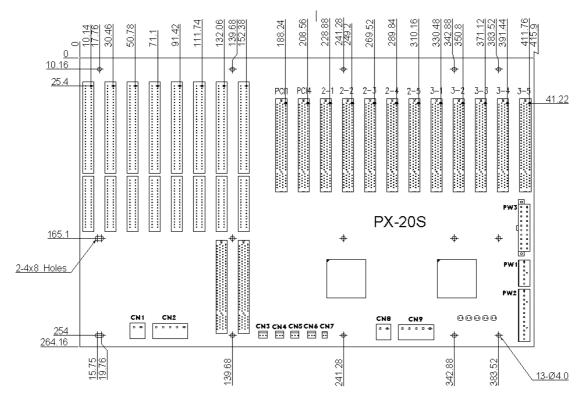

Connectors

CONNECTOR	DESCRIPTION
ISA13/ISA14/SLOT1 & ISA15/ISA16/SLOT2	PICMG connectors
PCI1-PCI12	32-BIT PCI BUS connectors
ISA1/ISA2-ISA11/ISA12	16-BIT ISA BUS connectors
PW2	P8/P9 power connector
PW1	P10 power connector
PW3	ATX power connector
CN1,CN2,CN8,CN9	DC power outlet
CN6	ATX P/S control connector
CN3-CN5	Fan connector
CN7	Power good signal output

Pin Assignment

P8/P9(PW2)				
PIN	NAME			
1	PWR OK			
2	+5V			
3	+12V			
4	-12V			
5	GND			
6	GND			
7	GND			
8	GND			
9	-5V			
10	+5V			
11	+5V			
12	+5V			

P10(PW1)				
PIN	NAME			
1	+5V			
2	+5V			
3	+5V			
4	GND			
5	GND			
6	GND			

Power Good output(CN7)			
PIN	NAME		
1	Power Good		
2	GND		

Pov	Power Extension(CN2,CN9)				
PIN	NAME				
1	+5V				
2	-5V				
3	-12V				
4	+12V				
5	GND				

Power Extension(CN1,CN8)				
PIN	NAME			
1	+3.3V			
2	GND			

ATX(PW3)					
PIN	NAME	PIN	NAME		
1	+3.3V	2	+3.3V		
3	+3.3V	4	-12V		
5	GND	6	GND		
7	+5V	8	PS_ON		
9	GND	10	GND		
11	+5V	12	GND		
13	GND	14	GND		
15	PWR OK	16	-5V		
17	STB5V	18	+5V		
19	+12V	20	+5V		

ATX control connector(CN6)				
PIN	NAME			
1	STB5V			
2	PS_ON			
3	GND			

Fan connector(CN3-CN5)				
PIN	NAME			
1	NC			
2	+12V			
3	GND			

Installation Guide

> Chassis

Make sure the copper lifting stands are placed below all the mounting holes of your backplane.

> SBC

Apply only one full-sized SBC over PICMG slot or half-sized SBC over ISA slot. Apply your ISA/PCI cards over ISA/PCI slot (Image 1).

> Power Supply

- 1.If you use AT power supply, attach the P8/P9 connector to PW2 (Image. 2).
- 2.If you use ATX power supply, attach the 20-pin ATX power connector to PW3 (Image. 3). Besides, you need to apply one 3-pin ATX power control cable between your SBC and backplane over the 3-pin header CN6. (A toggle switch is required over your SBC for this application. Image. 4).
- 3.If you use ATX power supply, you may also plug a switch into pin-2 and pin-3 of CN6. In this application, the 3-pin ATX power control cable is not required, and your ATX power supply will then act as AT power supply (Image. 5).

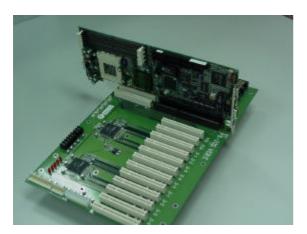


Image 1

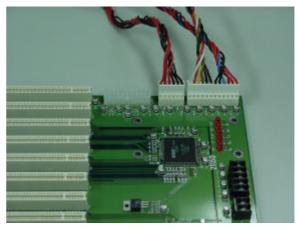


Image 2

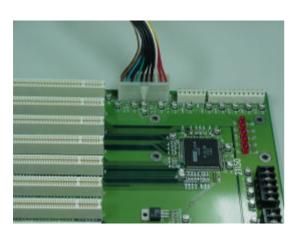


Image 3



Image 4



Image 5

> Fan

CN3, CN4 and CN5 are fan connectors. Please refer to the pin assignment table for proper connection.

> Additional Power Connectors

PW1 are additional power connectors used to draw more power and balanced the power distribution for full loading system. Users need to make a P8-like power connector with three +5V (P10) pins and three ground pins. For pin assignment, please refer to pin assignment section (Image 2)